OPERATING MANUAL

PRO 241-2

PRO 245-2

Absolute manometers





Contents

1	Gen	eral information	3				
	1.1	Product identification	3				
	1.2	Safety information	4				
2	Ove	rview	5				
	2.1	Scope of delivery	5				
3	Des	cription	6				
4	Preparing the instrument8						
5	Measurement mode						
	5.1 Hold function						
	5.2	Rel function	11				
	5.3	Reset of the statistical values	12				
6	Configuration						
	6.1	Menu structure	13				
	6.2	Configuring a parameter	15				
	6.3	Favorite functions (menu shortcuts)	16				
	6.4	Protected mode	17				
7	Measurement basics 1						
8	Measurement adjustment						
9	Logging (PRO 245-2 only)						
	9.1	Automatic logging	19				
	9.2	Single recording	19				
	9.3	Viewing the logged data	20				
	9.4	Deleting the logged data	20				
10	Seri	al communication	21				
11	Batt	ery management	22				
12	Mai	ntenance	23				
	12.1 Cleaning						
	12.2 Storage						
	12.3 Disposal						
13	Tech	nnical specifications	24				
14	Acce	essories	26				

General information 1

Read this document carefully and familiarize yourself with the operation of the device before using it. Keep this document ready to hand and in the immediate vicinity of the device so that it is always available to the personnel/user in case of doubt.

Only technically qualified persons are permitted to carry out commissioning, operation, maintenance and decommissioning. The personnel must have carefully read and understood the operating manual before starting any activity.

Legal notices

- For your safety, use only the manufacturer's original spare parts and accessories. We assume no responsibility for the use of other products and any resulting damage.
- The user must have adequate knowledge of the measuring process and use of the measurements. The user is liable in case of damage/danger due to misinterpretation of the measurements as a result of inadequate knowledge.
- The liability and warranty of the manufacturer for product damages and consequential damages are voided in the event of misuse, failure to comply with these operating instructions, failure to observe safety warnings, assignment to inadequately qualified technical personnel and arbitrary modifications of the device.
- No part of this document may be reproduced, modified or translated without prior written permission of the product manufacturer. In case of ambiguity between different language versions of this document, the English version applies.
- This document does not create any legally binding obligations for the product manufacturer. All legally binding obligations are included only in the General Terms and Conditions of Sale.

Correctness of content

- This document was checked for corrected contents and is subject to a continuous updating process. This does not rule out potential errors. In the event that errors are discovered or in case of suggestions to make this document more user-friendly, please inform us via the contact information given in this document.
- We reserve the right to change the product specifications and the contents of this document without prior notice.

Explanation of symbols used



Danger!

Warning of danger that could result in death, serious bodily injury, or serious property damage if not observed.



Caution!

Warning of potential danger or harmful situation that may cause damage to the device or the environment if not observed.



Attention!

Action that may have a direct effect on operation or may cause an unexpected behavior.

[**p**.4] Reference to the indicated page number.

1.1 Product identification

Exact product name can be found on device rear plate. The firmware version is displayed at startup. The info in this manual applies to devices with **firmware version 1.4.0.0 or later**.

1.2 Safety information

Fault-free operation and operational safety of the device can only be guaranteed if the general safety requirements and the specific safety requirements in this document are observed.

Do not use the device in climatic conditions other than those specified in this document.

Do not use the device in places with:

- Rapid ambient temperature variations that may cause condensation.
- Direct vibrations / shocks to the device.
- High-intensity electromagnetic fields or static electricity.

Intended use

The device is a handheld meter designed for measuring absolute pressure in air and non-aggressive dry gases.

Foreseeable misuse

If the following notices are disregarded, personal injury or death, as well as property damage can occur.



- Do not use in safety / emergency stop devices!
- Not suitable for use in hazardous areas (Ex-environments)!
- Not suitable for diagnostic or other medical purposes on patients!
- Not suitable for SIL (Safety Integrity Level)!
- The device is not suitable for contact with food!
- Not suitable for children!
- Do not use as PPE (Personal Protection Equipment).



Do not use if:

- There is visible damage to the device.
- The device is not working as expected.
- The device has been stored under unsuitable conditions for an extended period.

On suspicion that the device can no longer be operated without danger, it must be decommissioned and prevented from recommissioning with appropriate labelling.

In case of doubt, send the device to the manufacturer for repair or maintenance.

Attention!

Remove batteries to prevent leakage if the device is stored at a temperature above 50 °C or not used for an extended period of time.

2 Overview

PRO 241-2 and PRO 245-2 are professional handheld absolute pressure meters. PRO 245-2 also has data logging capabilities.

The meters have an internal digital absolute pressure sensor. Offset and slope user corrections allows compensating any possible sensor drift with time, for the best measuring accuracy.

Supplied with universal barbed pressure port for connecting 4 and 6 mm inner diameter hose. The pressure port is screwed to the meter by a standard G 1/8 thread, allowing the user to change it with a different type of port, if necessary, to fit his specific needs.

Detection of minimum, average and maximum values. The user can reset the statistical info to start a new statistical calculation.

Alarm thresholds can be set, to warn the user when the set values are exceeded.

The HOLD feature allows freezing the measurement on display, while the REL feature allows showing the measurement against a value determined by the user.

The meter can be connected to a PC via the USB-C port, for data acquisition in COM interface mode. The logger version PRO 245-2 can operate in Mass storage mode, for viewing or downloading the files stored in the internal memory or connecting to the **ProXware** application software.

Powered by 4 standard AA size alkaline batteries. For permanent operation, the instruments can also be powered via the USB-C port by a standard 5 Vdc standard power adapter or suitable power bank.

The configurable auto-off feature and LCD backlight level allows for more energy saving options.

2.1 Scope of delivery


PRO 241-2 is supplied with:

- Quick start guide
- Sheet with Master PIN
- 4 alkaline batteries. AA size
- 1 PVC hose, inner Ø 4 mm, outer Ø 6 mm
- Test report

PRO 245-2 is additionally supplied with a USB cable.

The **ProXware** application software is downloadable from Senseca website.


3 Description

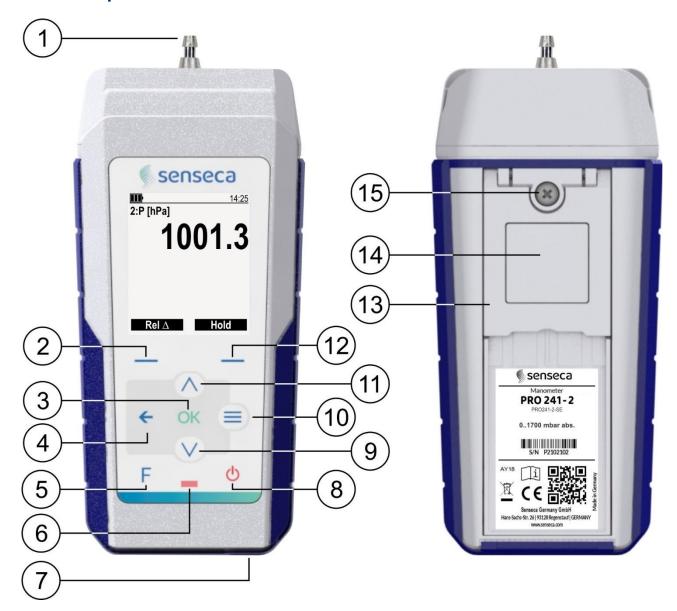

- **1.** Pressure port.
- 2. Left function key: runs the command shown at the bottom left on display.
- 3. OK key: confirms the selection.
- **4.** ← key: in measurement display cycles through the various available visualization modes; in the menu goes up one level, cancelling any unconfirmed changes.
- **5. F** key: favorite functions (menu shortcuts).
- 6. Status LED.
- 7. USB-C port for connecting the PC or the external power supply.
- **8. ON/OFF** key: turns the instrument on/off.
- 9. **Down arrow** key: scrolls down in a list or decreases the value of a parameter.
- **10. MENU** key: enters the configuration menu.
- 11. Up arrow key: scrolls up in a list or increases the value of a parameter.

- 12. Right function key: runs the command shown at the bottom right on display.
- **13.** Foldable stand: pull to open the stand.
- **14.** Magnet, for attachment to metal surfaces.
- **15.** Battery compartment fixing screw.

DISPLAY

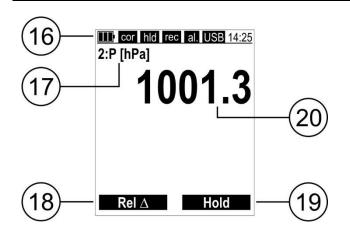

Symbols in the status bar:

Battery charge level

External power supply connected

cor Measurement correction applied

ck Protected mode active (*)

hld Hold function active

rec Logging in progress

al. Measurement in alarm

USB USB port connected to PC

14:25 Current time

- 16. Status bar.
- 17. Measured parameter and unit of measurement.
- **18.** Function corresponding to the left function key.
- **19.** Function corresponding to the right function key.
- 20. Measured value.


^(*) lck and cor symbols share the same position; cor has priority over lck, which is not displayed if cor is on.

4 Preparing the instrument

Power supply

The instrument is powered by 4 AA size alkaline batteries, already assembled in the device as standard.

If for some reason (e.g., shipping rules) the batteries are not already assembled, unscrew the battery cover fixing screw and remove the cover, then insert the batteries as shown below.

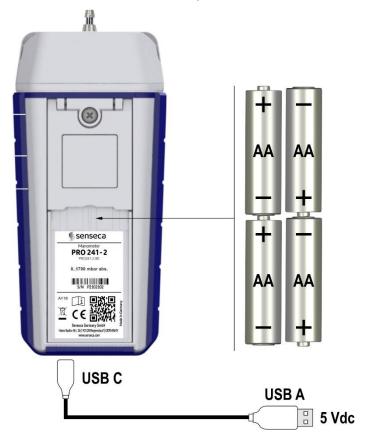

The instrument can also be powered via the USB-C port by a 5 Vdc standard power adapter or power bank. If a power bank is used, make sure it is of appropriate capacity and does not have the auto-shutdown function when the current draw is very low (for example, suitable power banks are those in the Varta Power Bank Energy series).

Pressure port connection

The instrument is supplied as standard with universal barbed pressure port for 4 and 6 mm inner diameter hose.



Attention!

Use a hose with a diameter compatible with the pressure port. The inner diameter of the hose should not be too large to avoid pressure loss and should not be too small to avoid mechanically forcing the port when inserting the hose.

Caution!

- Use a hose suitable for the pressure to be measured.
- It is recommended that the hose is not under pressure during connection.
- It is recommended to secure the hose to the pressure port with a hose clamp when measuring pressures above 1 bar. GDZ-18 hose clamp is available as optional accessory.


The pressure port is interchangeable. It is possible to unscrew the port to replace it with a port of a different type, provided it has G 1/8 thread. When tightening the port, use a suitable tool and observe the maximum torque of 2 Nm.

5 Measurement mode

To switch on the instrument, press the ON/OFF key. After a few seconds, the instrument displays the measured value.

Note: when the instrument is turned on for the first time, it automatically enters the menu displaying some factory settings (language, date/time, etc.); press repeatedly OK to accept the proposed settings or change them as indicated in the Configuration chapter $[\triangleright p.13]$.


By repeatedly pressing the \leftarrow key, measurements can be displayed in different formats:

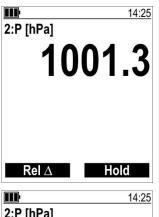

Parameter displayed in large format.




Parameter displayed in medium format.

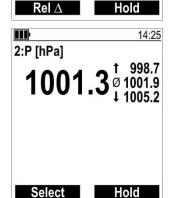

Parameter displayed in medium format with indication of maximum (\uparrow), average (\varnothing) and minimum (\downarrow) values.



One parameter displayed in large format and the remaining in small format.

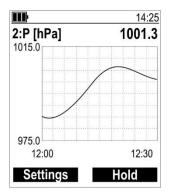

Parameter displayed numerically and graphically.

To change the unit of measurement, see the Configuration chapter [p.13].

5.1 Hold function


The **Hold** function, which can be activated/deactivated by pressing the right function key, freezes the current measurement value on the display.

The function activation is highlighted by the hld symbol in the status bar of the display.

5.2 Rel function

The **Rel** function displays the relative measurement against a reference value, consisting of the measurement value at the time the function is activated.

To activate the relative measurement, press the left function key ($Rel \Delta$), the measurement is highlighted in negative, then press the left function key (Δ on). The symbol Δ and the reference value appear on display.

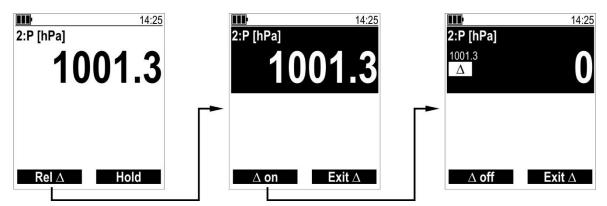

To disable the relative measurement, press the left function key (Δ off) again.

By pressing the right function key (**Exit** Δ), the instrument exits the relative measurement enable/disable (Δ on/off) mode.


The **Rel** Δ command is not available:

- in the screen with the statistical values;
- in the screen with the graph;
- while logging.

5.3 Reset of the statistical values

To reset the statistical values, press the left function key (**Select**) in the measurement screen with the maximum/medium/minimum values, the measurement is highlighted in negative, then press the left function key (**Clear**).


To exit the statistical values reset mode, press the right function key (Exit).

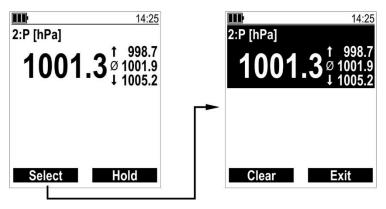

6 Configuration

Press the **MENU** key to enter the configuration menu.

The menu is structured in levels. The current level is indicated by the number of overlapping bars in the menu header:

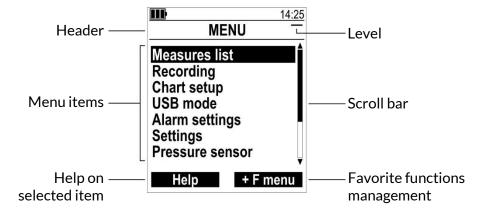

Use the **down/up arrow** keys to select an item, press **OK** to confirm.

The presence of the scroll bar indicates that there are additional items available beyond those displayed.

The left function key (**Help**) provides a description of the selected item. If the help function is entered, press the left function key (**Help off**) again to exit.

The right function key (+ F menu or - F menu) adds or remove the selected item to or from the list of favorite functions [▶ p.16].



It is not possible to access the menu if the instrument is logging.

6.1 Menu structure

The menu structure is shown below; each item is preceded by the level according to the bar symbology shown on the display.

MENU	DESCRIPTION				
- Measures list	Selection of the quantities to display and log				
- Recording	Only PRO 245-2				
= Start recording	Automatic logging start				
= Set interval	Setting of logging interval: 1/2/5/10/15/30 s, 1/2/5/10/15/30 min, 1 h				
= Mode	Setting of single recording mode				
= Single recording	Manual storing of the current measurements (single sample)				
- Chart setup	Setting of the measurement graphical display				
= Channel select	Selection of parameters to be displayed graphically (selectable from those enabled in the "Measures list" menu)				
= Chart interval	Chart measurement interval: 1/2/5/10/15/30 s, 1/2/5/10 min				

MENU	DESCRIPTION						
– USB mode	Configurable only in PRO 245-2 between COM interface (for logging and serial communication) or Mass storage (for viewing logging files from PC). In PRO 241-2 the mode is always COM interface.						
– Alarm settings	Type of alarm signaling: Off, acoustical (buzzer) and/or optical (flashing backlight and red flashing status LED)						
- Settings							
= Device info	Displaying of instrument info (model, S/N, FW revision,)						
= Backlight	Backlight configuration						
■ BL activation	Backlight duration: Off, 5 s, 30 s, 1 min, always On						
■ BL intensity	Backlight intensity: Low, Medium, High						
= Auto-off	Auto-off setting: Off, 30 min, 1/2/4/6/12 h						
= Date & time	Setting of date and time (yyyy-mm-dd hh:mm:ss)						
= Time zone	UTC or CET time zone setting						
= Language	Selection of the menu language						
= PIN configuration	Protected mode configuration						
■ Activate PIN code	Protected mode enabling/disabling						
≡ Set PIN	Setting of access code						
= Dark mode	Black background enabling/disabling						
= Factory reset	Reset to factory settings						
- Pressure sensor	Measurement settings						
= Measures units	Setting of the unit of measurement						
= Alerting	Alarm thresholds enabling/disabling						
= Min. alarm ^(*)	Lower alarm threshold (alarm if measure < threshold)						
= Max. alarm ^(*)	Upper alarm threshold (alarm if measure > threshold)						
= Hysteresis (*)	Thresholds hysteresis						
= Correction	Measurement adjustment						
≡ Zero point	Offset adjustment						
≡ Gradient	Slope adjustment						
= Probe info	Information on the sensor						

^(*) The item does not appear if "Alerting" is set to "Off"; to display the item, first select a measure/channel to associate the alarm with.

To go back up one level within the menu, press the \leftarrow key. The **MENU** key allows exiting the menu directly and return to measurement mode from any level (except from parameter setting screens, from which you can exit only with \leftarrow).

6.2 Configuring a parameter

Configuring a parameter may require choosing an option from those proposed, or setting a numerical value.

Configuring a parameter by choosing an option from those proposed:

The current setting is marked by the check mark. To change it, choose an option with the **down/up arrow** keys, then press **OK** to confirm.

Pressing the \leftarrow key it is possible to exit by canceling changes not yet confirmed.



Configuring a parameter by setting a numerical value:

Select the various digits using the function keys (< >). To change a digit, use the **down/up arrow** keys. When finished, press **OK** to confirm the value.

Pressing the \leftarrow key it is possible to exit by canceling changes not yet confirmed.



6.3 Favorite functions (menu shortcuts)


Frequently used menu items can be added to a list of favorite functions so that they are easily accessible without the need to navigate the menu structure.

To add a menu item to the list of favorite functions, select it in the menu and press the right function key (+ F menu). Items added to the list of favorite functions are marked with the symbol \bigstar .



The favorite functions can be accessed from the measurement screens by pressing the **F** key. To execute a favorite function, select it with the **down/up arrow** keys, then press **OK** to confirm.

The list of the favorite functions can be edited by pressing the right function key (**Edit**).

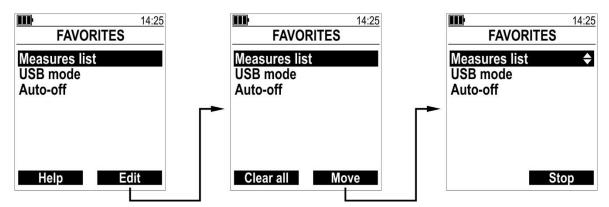

The left function key (Clear all) deletes the entire list.

To change the position of a function, select it with the **down/up arrow** keys, press the right function key (**Move**), move the quantity with the **down/up arrow** keys, and press the right function key (**Stop**).

Press the \leftarrow key to exit from the function list editing mode.

To delete a single menu item from the list of favorite functions, select it in the menu and press the right function key (- F menu): the symbol ★ disappears.



For security reasons, It is not possible to add the menu items "Activate PIN code", "Set PIN", and "Factory reset" to the list of favorite functions.

6.4 Protected mode

The configuration of the instrument can be protected with a numeric code (PIN) that is required to access the menu or send serial commands.

By default, the protected mode is disabled. To enable the protected mode, select **Settings** > PIN configuration → Activate PIN code → Yes and press OK. You are prompted to enter the PIN, which is **0** by default. Set the PIN, if different from the default, using the **down/up arrow** keys and function keys (< >), then press **OK**, the instrument returns to the setting screen with protected mode enabled.

The protected mode activation is highlighted by the ck symbol in the status bar of the display.

Attention!

ck is not displayed if cor is on, because the two symbols share the same position and cor has priority over ck.

Upon exiting the menu after activating the protected mode, the mode is immediately active. If the menu is entered when the mode is already active (thus entering the access PIN), upon exiting the menu the PIN request to re-enter the menu is reactivated 2 minutes after the last key press (in the meantime, it is possible to re-enter the menu without entering the PIN), unless the 2 minutes without pressing keys have already elapsed within the menu, in which case the PIN request to re-enter the menu is reactivated immediately upon exiting the menu.

In protected mode, accessing the menu by entering the PIN does not automatically unlock serial communication, and sending the PIN via the appropriate serial command [▶ p.19] does not automatically unlock menu access.

Attention!

Menu items added to the list of favorite functions are not protected if accessed via the \mathbf{F} key.

Changing the PIN:

The code can be set from 0 to 9999 (default = 0).

To change PIN, select **Settings** → **PIN configuration** → **Set PIN**, set PIN using **down/up arrow** keys and function keys (< >), then press **OK**, a message appears to remind you to activate protected mode, press Help Off to close the screen.



Attention!

Changing the PIN automatically disables the protected mode if it is active. After changing the PIN, it is necessary to reactivate the protected mode again.

Attention!

In the package of the instrument there is a sheet with a Master PIN, different for each instrument, which allows access to the protected features in case the user forgets the PIN after changing it.

If you lose your Master PIN sheet, you can request a copy by indicating the serial number of your device.

Measurement basics

The instrument internal pressure sensor detects the absolute pressure applied to the input.

Caution!

- Do not exceed the maximum overpressure specified, the sensor may be damaged.
- The sensor is suitable for measurement in air and non-aggressive dry gases: do not use for measurement in corrosive gases.
- Avoid performing measurements in the presence of high-frequency sources, microwaves or strong magnetic fields.
- Connect the hose to the instrument without forcing or bending the pressure port.

Measurement adjustment

The measurement can be adjusted by setting the following parameters, available in the Pressure sensor → Correction:

• **Zero point**: adds an offset (P_{offs}) to the measurement.

Displayed value = Measured value + Poffs

• **Gradient**: applies a percentage correction (C_{slope}%) to the measurement. Zero indicates no correction.

Displayed value = (Measured value + P_{offs}) * (1 + C_{slope} % / 100)

If a measurement correction is applied by setting a value other than zero for the "Zero point" and/or "Gradient" parameters, the cor symbol appears on the display.

9 Logging (PRO 245-2 only)

The logging function stores in the memory of the instrument the detected measurements, along with the date and time of each sample. Data recording can be automatic, according to the set interval, or single (manual).

Attention!

- To use the logging function, the **USB mode** menu item must be set to **COM interface**.
- The Logging function records only the quantities enabled in the measurement screens. Before starting logging, make sure that all quantities of interest are enabled.

9.1 Automatic logging

The automatic logging data are stored in **CSV** format.

To start automatic logging, select the **Start recording** item from the **Recording** menu.

By selecting "Start recording," the instrument automatically exits the menu. It is not possible to access the menu during logging.

The logging activation is highlighted by the rec symbol in the status bar of the display. During logging, the status LED briefly flashes green every 5 seconds.

With logging active, in the measurement screens the left function key assumes the function of **Stop** logging.

During logging, the instrument auto-off is disabled.

9.2 Single recording

The single recordings data are stored in a single file in **JSON** format (history.json). The new recordings are added to existing recordings, which are not deleted.

Three modes are available for single recording, which can be selected in the **Recording > Mode** menu:

- Standard
- Multiselect
- On hold

Standard mode:

To make a single recording, select the **Single recording** item of the **Recording** menu, then select with the **down/up arrow** keys one of the available labels (Location xx) and press **OK** to confirm and save the measurement data.

During data saving, the rec symbol lights up in the status bar of the display.

The selected label is marked with the check mark. The label associated with the recording is useful for distinguishing the various recordings in the data file, which is unique for all single recordings. The label may, for example, represent the location where the recording takes place; recordings made in different locations may be associated with different labels. There are 20 distinct labels available (Location 1...20).

Multiselect mode:

Operation is similar to standard mode, except that the check mark always remains visible next to all labels that are selected (in standard mode only the last label selected is marked with the check mark).

The left function key **Clear**, which appears on the label list screen, removes all checkmarks from the list (but does not clear the data). The function key appears only if there is at least one check mark.

On hold mode:

Operation is similar to the standard mode, with the added option of directly accessing the label list when the Hold function key, which becomes **Hold/rec**, is pressed.

If, after pressing the **Hold/rec** function key, a label is selected and **OK** is pressed, the data is saved and the instrument returns to measurement mode, exiting the Hold function. If instead OK is not pressed to save the data, but the menu is exited to return to measurement mode, the instrument remains in Hold.

Changing the labels name:

The label names can be customized with the following serial command:

updateLocation: n, name

where n is the label index (1...20). The name has a maximum length of 16 characters.

9.3 Viewing the logged data

The instrument can be connected to the PC via a standard USB-C cable. The instrument is viewed by the PC as a mass storage device containing the various data files.



For viewing files from PC, logging must be off and the **USB mode** menu item must be set to **Mass storage**.

The **ProXware** application software can be used to read the CSV files.

JSON files can be imported into Microsoft Excel® (Data \rightarrow Get data \rightarrow From file \rightarrow From JSON menu). See the Microsoft Excel® help for details on the data import procedure.

9.4 Deleting the logged data

The log files can be erased from the PC using a file manager.

10 Serial communication

Serial commands can be sent to the instrument, to read the instrument information and the measurements.

To send serial commands to the instrument, the **USB mode** menu item must be set to **COM** interface.

In the serial communication software used ⁽¹⁾, the PC COM port number to which the instrument is connected has to be set.

Recommended communication parameters:

- Baud rate = 115200
- Data bits = 8
- Stop bits = 1
- Parity = None

The full list of commands supported by the model, with their description, is obtained by sending the following command:

GetCommandList: 0<*CR*><*LF*>

<CR> = Carriage Return

<LF> = Line Feed

Between the characters ":" and "0" of the command there is a space.

All command strings sent to the instrument must be terminated by the *<CR><LF>* control characters.

Serial communication in protected mode:

If the protected mode is active [p.17], the following command must be sent to activate serial communication:

setPINCode: nnnn

where nnnn is the PIN.

The default PIN is **0000**. The PIN must always be written with 4 digits (e.g., 0023 for 23).

After the PIN is sent, the serial communication is locked again if the instrument does not receive serial commands for 2 minutes.

Attention!

In the package of the instrument there is a sheet with a Master PIN, different for each instrument, which allows access to the protected features in case the user forgets the PIN after changing it.

If you lose your Master PIN sheet, you can request a copy by indicating the serial number of your device.

¹ Any standard serial communication software, e.g., "HTerm", can be used.

11 Battery management

If the external power supply is not connected, the battery symbol on the display indicates the battery charge level.

If the battery charge is insufficient to ensure a correct measurement, the instrument turns off. The data remains stored even with low batteries.

In case of discharged batteries it is necessary to replace the batteries: unscrew the battery cover fixing screw and remove the cover, take out the exhausted batteries and insert 4 new AA size alkaline batteries [p.8], then screw the cover back on.



Attention!

If you plan to use the instrument on battery power alone, make sure the charge is sufficient to complete the measurements.

Tips:

To increase the battery autonomy, it is possible to reduce the brightness of the backlight and/or enable the instrument auto-off (see Configuration chapter [▶ p.13]).



⚠ Danger!

- Do not short-circuit the batteries, they may explode with serious risk to people!
- Do not expose the batteries to high temperature!
- Do not throw the batteries into fire!



⚠Caution!

Disposal: Dispose the exhausted batteries in the appropriate bins or deliver them to authorized collection centers. Comply with current regulations.

12 Maintenance

It is recommended to perform a calibration check of the instrument annually at accredited laboratories.

12.1 Cleaning

Do not use aggressive cleaning agents or incompatible with the materials indicated in the technical specifications. For cleaning, use a soft dry cloth or slightly dampened with clean water.

12.2 Storage

It is advisable to remove the batteries if the product is stored for a long time.



Do not store the product where:

- Humidity is high.
- The product is exposed to direct sunlight.
- The product is exposed to a source of high temperature.
- There are strong vibrations.
- There is vapor, salt and/or corrosive gas.

12.3 Disposal



Electrical and electronic equipment marked with specific symbol in compliance with 2012/19/EU Directive must be disposed of separately from household waste. European users can hand them over to the dealer or to the manufacturer when purchasing a new electrical and electronic equipment, or to a WEEE collection point designated by local authorities. Illegal disposal is punished by law.

Disposing of electrical and electronic equipment separately from normal waste helps to preserve natural resources and allows materials to be recycled in an environmentally friendly way without risks to human health.

13 Technical specifications

Measurement specifications

Measuring range	01700.0 hPa			
Resolution	0.1 hPa			
Accuracy	±2 hPa tip. @ T=530 °C ±1.25 %FSS			
Measurement rate	4 meas./s			
±3000 hPa	±3000 hPa			
Compatible media	Air and non-aggressive dry gases			

Units of measurement

	Pa	hPa	kPa	bar	mbar	in Hg	mm Hg	in H ₂ O	mm H ₂ O	psi	Kgf/ cm ²
PRO 24x-2		V	√	V	√	1	√				

General specifications

Input channels	1 absolute 1 x universal barbed pressure port for 4 and 6 mm inner diameter hose Interchangeable G 1/8 thread connection
Storage capacity (only PRO 215-x)	Up to 1 million data sets, file system based. Each data set includes measurements of all channels and date/time stamp.
Logging type (only PRO 215-x)	Automatic with manual start/stop or manual single recording
Logging interval (only PRO 215-x)	1, 2, 5, 10, 15, 30 s / 1, 2, 5, 10, 15, 30 min / 1 h
Clock	User settable RTC Max. drift 1 min/month @ 25 °C
Display	140 x 160 dot matrix backlit LCD Visible area 42 x 50 mm
User interface	Multilingual (en, de, it, fr, es)
PC connection	USB-C, Mass Storage Device (only PRO 245-2)
Power supply	4 x AA alkaline batteries External 5 Vdc via USB C
Power consumption	10 mA typ. (15 mA typ. with USB operation)
Battery autonomy	> 250 h typ. continuous operation (backlight off)
Auto power off	Yes, user configurable
Operating conditions	-550 °C / 085 %RH non-condensing

Storage temperature	-2565 °C (without batteries)				
Protection degree	IP 67 (except pressure inputs) IK 06				
Dimensions	170 x 80 x 38 mm				
Weight	345 g approx.				
Housing material	ABS, TPE (side protection), Polyester (front panel)				

14 Accessories

Spare and optional pressure ports:

GDZ-UT



Universal barbed pressure port for 4 and 6 mm inner diameter hose.

Art. No. 479260

Spare part - Included in the scope of supply

GDZ-QC6



 $\label{eq:Quick coupling pressure port for 4\,mm inner diameter} Quick coupling pressure port for 4\,mm inner diameter$

hose.

Art. No. 479261

GDZ-ST6



Screw coupling pressure port for 4 mm inner diameter

hose.

Art. No. 479466

GDZ-MCF



2.7 mm nominal diameter mini female quick coupling

for 4 mm inner diameter hose.

Art. No. 480221

GDZ-MCM



2.7 mm nominal diameter mini male quick coupling

for 4 mm inner diameter hose.

Art. No. 479467

Other accessories:

GDZ-01-02



PVC hose 6/4 (6 mm outer Ø, 4 mm inner Ø).

Max. 5 bar at 23 °C.

Art. No. 604158

GDZ-18



Hose clamp for hose 6/4.

Art. No. 601576

GDZ-31-02



PVC hose 8/5 (8 mm outer \emptyset , 5 mm inner \emptyset).

Max. 2 bar at 23 °C. Max. 200 °C.

Art. No. 480659

CASE PRO-400



Case for PRO Line.

Recess for one instrument, space for accessories, carrying handle, zipper.

Dimensions: $415 \times 245 \times 70 \text{ mm}$ (W x H x D).

Art. No. 486900

senseca.com



Senseca Germany GmbH
Hans-Sachs-Strasse 26
93128 Regenstauf
GERMANY
info@senseca.com

